

Service

BULLETIN # 131

JANUARY 28, 2008

PAGE 1/1

MODELS AFFECTED

P-25, P-26, P-30, P-40

SUBJECT

ROCKER COVER LEAKAGE

A recent design change by Cummins on rocker cover gaskets for 86NT engines, has resulted in possible top end engine leaks when used with model P-25, P-26, P-30 and P-40 Pacbrake housings.

The limited sealing surface on Cummins gasket Part #3067459 does not provide adequate width to mate with the top of model P-25, P-26, P-30 and P-40 housings.

Use the Pacbrake laminated cork gasket part #P04841 or equivalent.

Pacbrake Service

