

**SUBJECT****Correction to the Installation Manual****MODEL NUMBER****C20000 and C20002**

**Pacbrake has found that an error exists in our C20000 and C20002 Installation Manuals.**

Step 15 and the wiring schematic both refer to the exhaust brake power supply to be a RED wire with a BLACK trace. This wire is only 8.5 volts, not 12 volts as required. Using the RED wire with BLACK trace will activate the compressor but cause it to draw high amperage. The customer complaint will be that the compressor blows the 15 amp fuse. The repair procedure is to move the exhaust brake power supply from the RED with BLACK trace and connect it to the 14 gage RED with GREEN trace.

Contact **Pacbrake** Service at **1 800 663 0096**