

Service

BULLETIN #151

SEPT 2000

PAGE 1/1

MODELS AFFECTED

P-39A


SUBJECT

**IMPROVED SOLENOID IN P-39A ENGINE
BRAKE FOR CAT C-15/C-16 ENGINES**



Pacbrake has released its improved solenoid which eliminates the lead wires and terminal block.

Caterpillar's undercover wiring will now plug directly onto the external solenoid tabs facilitating easier installation or replacement. The new P39015 solenoid is a direct replacement for P04215 and also eliminates the P02750 button head screw and P02751 lock washer.

P39015 (new)

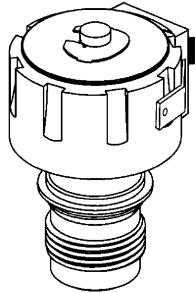

P04215

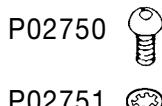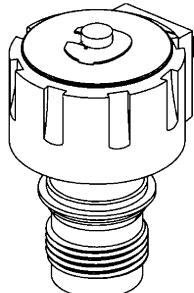

This is a product improvement not subject to campaign.

Pacbrake Service

PACBRAKE
ENGINE & EXHAUST BRAKES

Phone: 800-663-0096 • Fax: 604-882-9278 • E-mail: info@pacbrake.com • Internet: www.pacbrake.com
Canada: 19594 - 96 Ave., Surrey, BC V4N 4C3 • USA: P.O. Box 1822, 250 H St, Blaine, WA 98231-1822